

Adapters

■ Features

- Used to connect different types or diameters of screws or pipes
- Variable specifications for sizes and applications
- Applications
 - Connecting different types or diameters of screws or pipes
 - Mounting a pressure gauge on a panel
 - Connecting pressure pipes




■ Specifications


Series	SS-AD	
Material	Body	Brass
	Packing (Gasket-Outlet)	Teflon
	Washer	BSBM
Type	• PF(Male) x PF(Male) • PF(Male) x PT(Female) • PT(Female) x PF(Male) • PT(Female) x PT(Female)	
	Stainless steel	SUS316

■ Dimensions

(unit:mm)

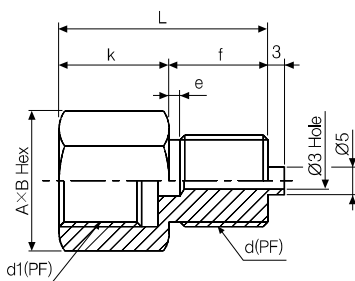


Model	Connector (d1)	Connector (d)	A×B Hex	k	f	L	e
SS-AD01 (PF)×(PF)	PF1/4	PF1/4	19×21.9	18	16	34	2
	PF1/4	PF3/8	19×21.9	18	18	36	2
	PF1/4	PF1/2	22×25.4	18	20	38	2
	PF3/8	PF1/4	22×25.4	20	16	36	2
	PF3/8	PF3/8	22×25.4	20	18	38	2
	PF3/8	PF1/2	22×25.4	20	20	40	2
	PF1/2	PF1/4	27×31.1	22	16	38	2
	PF1/2	PF3/8	27×31.1	22	18	40	2
	PF1/2	PF1/2	27×31.1	22	20	42	2

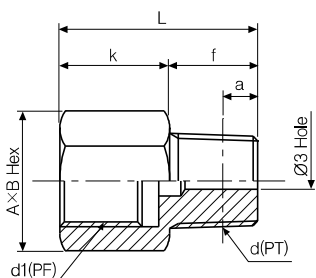


Model	Connector (d1)	Connector (d)	A×B Hex	k	f	L	a
SS-AD02 (PF)×(PT)	PF1/4	PT1/4	19×21.9	18	14	32	6.01
	PF1/4	PT3/8	19×21.9	18	16	34	6.35
	PF1/4	PT1/2	22×25.4	18	18	36	8.16
	PF3/8	PT1/4	22×25.4	20	14	34	6.01
	PF3/8	PT3/8	22×25.4	20	16	36	6.35
	PF3/8	PT1/2	22×25.4	20	18	36	8.16
	PF1/2	PT1/4	27×31.1	22	14	36	6.01
	PF1/2	PT3/8	27×31.1	22	16	38	6.35
	PF1/2	PT1/2	27×31.1	22	18	40	8.16


(unit:mm)

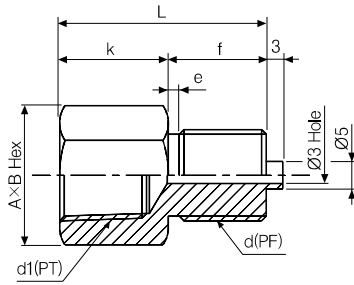


Model	Connector (d1)	Connector (d)	AxB Hex	k	f	L	e
SS-AD03 (PT)×(PF)	PT1/4	PF1/4	19×21.9	16	16	32	2
	PT1/4	PF3/8	19×21.9	16	18	34	2
	PT1/4	PF1/2	22×25.4	16	20	36	2
	PT3/8	PF1/4	22×25.4	18	16	34	2
	PT3/8	PF3/8	22×25.4	18	18	36	2
	PT3/8	PF1/2	22×25.4	18	20	38	2
	PT1/2	PF1/4	27×31.1	20	16	36	2
	PT1/2	PF3/8	27×31.1	20	18	38	2
	PT1/2	PF1/2	27×31.1	20	20	40	2

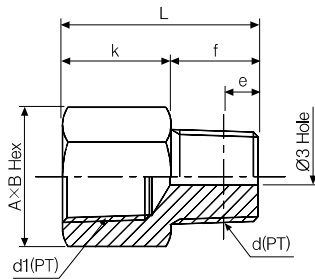

Model	Connector (d1)	Connector (d)	AxB Hex	k	f	L	e
SS-AD04 (PT)×(PT)	PT1/4	PT1/4	19×21.9	16	14	30	6.01
	PT1/4	PT3/8	19×21.9	16	16	32	6.35
	PT1/4	PT1/2	22×25.4	16	18	34	8.16
	PT3/8	PT1/4	22×25.4	18	14	32	6.01
	PT3/8	PT3/8	22×25.4	18	16	34	6.35
	PT3/8	PT1/2	22×25.4	18	18	36	8.16
	PT1/2	PT1/4	27×31.1	20	14	34	6.01
	PT1/2	PT3/8	27×31.1	20	16	36	6.35
	PT1/2	PT1/2	27×31.1	20	18	38	8.16

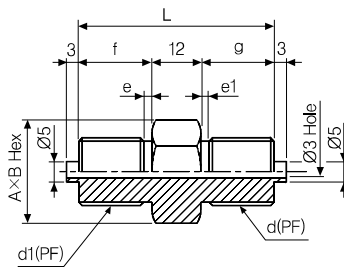


Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L	e	e1
SS-AD05 (PF)×(PF)	PF1/4	PF1/4	19×21.9	16	16	44	2	2
	PF1/4	PF3/8	19×21.9	16	18	46	2	2
	PF1/4	PF1/2	22×25.4	16	20	48	2	2
	PF3/8	PF1/4	19×21.9	18	16	46	2	2
	PF3/8	PF3/8	19×21.9	18	18	48	2	2
	PF3/8	PF1/2	22×25.4	18	20	50	2	2
	PF1/2	PF1/4	22×25.4	20	16	48	2	2
	PF1/2	PF3/8	22×25.4	20	18	50	2	2
	PF1/2	PF1/2	22×25.4	20	20	52	2	2

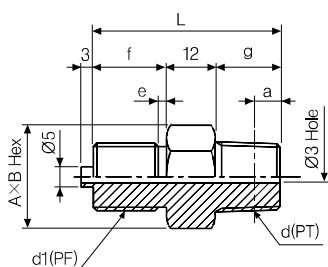


Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L	e	a
SS-AD06 (PF)×(PT)	PF1/4	PT1/4	19×21.9	16	14	42	2	6.01
	PF1/4	PT3/8	19×21.9	16	16	44	2	6.35
	PF1/4	PT1/2	22×25.4	16	18	46	2	8.16
	PF3/8	PT1/4	19×21.9	18	14	44	2	6.01
	PF3/8	PT3/8	19×21.9	18	16	46	2	6.35
	PF3/8	PT1/2	22×25.4	18	18	48	2	8.16
	PF1/2	PT1/4	22×25.4	20	14	46	2	6.01
	PF1/2	PT3/8	22×25.4	20	16	48	2	6.35
	PF1/2	PT1/2	22×25.4	20	18	50	2	8.16

SS-AD Series


(unit:mm)

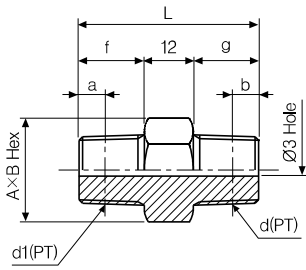


Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L	a	b
SS-AD07 (PT)×(PT)	PT1/4	PT1/4	19×21.9	16	14	30	6.01	6.01
	PT1/4	PT3/8	19×21.9	16	16	32	6.35	6.35
	PT1/4	PT1/2	22×25.4	16	18	34	8.16	8.16
	PT3/8	PT1/4	19×21.9	18	14	32	6.01	6.01
	PT3/8	PT3/8	19×21.9	18	16	34	6.35	6.35
	PT3/8	PT1/2	22×25.4	18	18	36	8.16	8.16
	PT1/2	PT1/4	22×25.4	20	14	34	6.01	6.01
	PT1/2	PT3/8	22×25.4	20	16	36	6.35	6.35
	PT1/2	PT1/2	22×25.4	20	18	38	8.16	8.16

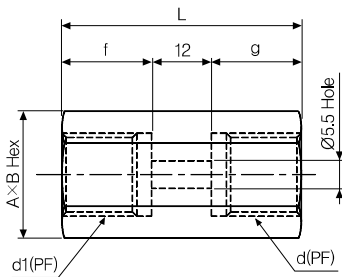

Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L
SS-AD08 (PF)×(PF)	PF1/4	PF1/4	19×21.9	16	16	44
	PF1/4	PF3/8	22×25.4	16	18	46
	PF1/4	PF1/2	27×31.1	16	20	48
	PF3/8	PF1/4	22×25.4	18	16	46
	PF3/8	PF3/8	22×25.4	18	18	48
	PF3/8	PF1/2	27×31.1	18	20	50
	PF1/2	PF1/4	27×31.1	20	16	48
	PF1/2	PF3/8	27×31.1	20	18	50
	PF1/2	PF1/2	27×31.1	20	20	52

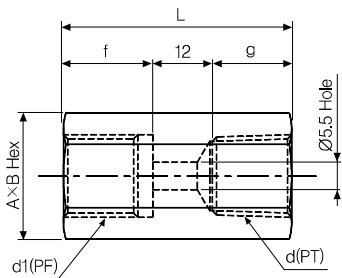

Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L
SS-AD09 (PF)×(PT)	PF1/4	PT1/4	19×21.9	16	14	42
	PF1/4	PT3/8	22×25.4	16	16	44
	PF1/4	PT1/2	27×31.1	16	18	46
	PF3/8	PT1/4	22×25.4	18	14	44
	PF3/8	PT3/8	22×25.4	18	16	46
	PF3/8	PT1/2	27×31.1	18	18	48
	PF1/2	PT1/4	27×31.1	20	14	46
	PF1/2	PT3/8	27×31.1	20	16	48
	PF1/2	PT1/2	27×31.1	20	18	50

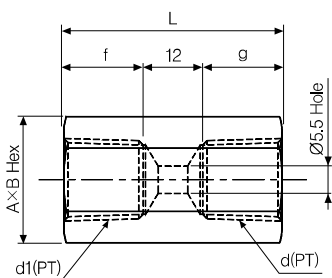

Model	Connector (d1)	Connector (d)	AxB Hex	f	g	L
SS-AD10 (PT)×(PT)	PF1/4	PT1/4	19×21.9	16	14	30
	PF1/4	PT3/8	22×25.4	16	16	32
	PF1/4	PT1/2	27×31.1	16	18	34
	PF3/8	PT1/4	22×25.4	18	14	32
	PF3/8	PT3/8	22×25.4	18	16	34
	PF3/8	PT1/2	27×31.1	18	18	36
	PF1/2	PT1/4	27×31.1	20	14	34
	PF1/2	PT3/8	27×31.1	20	16	36
	PF1/2	PT1/2	27×31.1	20	18	38